


www.decorettestore.com

INSTRUCTION SHEET How to Apply Vinyl Decals to

Glass Surface (Wet Application)

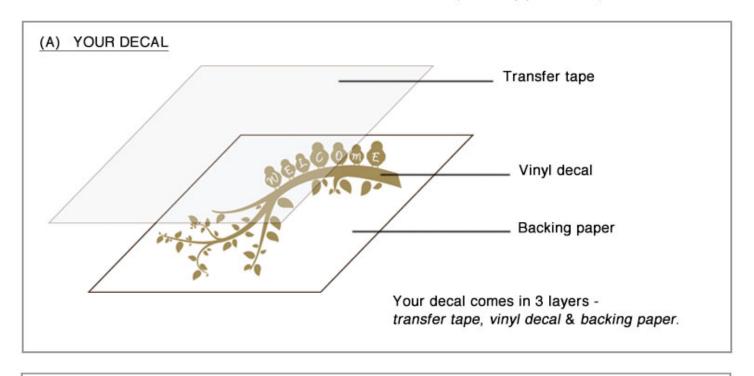

(B) GET READY THESE TOOLS



Spray Bottle of Application Fluid mix half teaspoon of soap with 250ml water



Lint-free Cloth such as microfiber cloth





Squeegee / a Hard Card e.g. Credit Card



Masking Tape

(C) PREPARING YOUR DECAL AND SURFACE



Remove decal from tube & unroll it on a flat surface.

Flip over & rub surface of backing paper with squeegee/hard card.

This helps the decal to adhere better to the transfer tape.



For decals that need assembling, cut & separate the different elements.



Clean glass so that it is free of dust and dirt.

AVOID soap that contains cream, citrus, silicones or ammonia, which interfere with adhesiveness.

(D) APPLYING YOUR DECAL



1. Determine the position of the decal on your glass.

Use the <u>actual decal</u> as a guide, NOT the edge of the transfer tape or backing paper.



Carefully remove the backing paper.

If decal sticks to the backing, press back, rub a little and try again. OR try peeling from another direction.

> Avoid touching the adhesive on the decal if you can.



Spray glass surface generously with application fluid.

Then spray adhesive side of the decal generously with application fluid.



Place the decal onto the glass surface.

While the decal is wet, you can adjust position of the decal without damaging it.



5. Once in place, rub the decal onto the surface using a squeegee/hard card with firm strokes, in a center to outwards direction, to push out the application fluid.

Repeat this a few more times until you are able to remove as much application fluid between the decal & the glass surface as possible.

NOTE:

When you remove the application fluid, you are also pushing out the bubbles, thus achieving a smooth, bubble-free installation.

Leave the transfer tape on for now.

Decal will only start to adhere once all the application fluid has evaporated.



202

6. Let the decal dry completely before you remove the transfer tape. Drying can take a day to a few days depending on how soapy the application fluid is & how much fluid is used during installation.

To test for dryness, you can test peel from one corner of the transfer tape. If the decal also peels off with the transfer tape, re-apply decal with squeegee and let it dry out more before attempting to remove it.

Once completely dried, peel off the transfer tape slowly and gently.

CARE:

To clean, gently dap decals with a lint-free cloth, making sure not to saturate the adhesive side with water.

Avoid using cleaners that contain alcohol, abrasives, citrus additives, or ammonias.